

A Study on the Shrinkage Control of Concrete Using Synthetic Fibers (Early age shrinkage control Module 1)

Suyash Khatavkar¹, Prof. M. S. Kakamare²

^{1,2}Dept. of Civil (Structural Engg.), PVPIT Budhgaon, Sangli- India

Abstract- Time dependent strain measured in an unloaded specimen at constant temperature is called as Shrinkage of concrete. Concrete is subjected to volume changes autogenously due to the volume change in concrete which is an undesirable property, affects long term strength and durability. Volume change in concrete causes unsightly cracks in concrete therefor volume change in concrete is important to the practical engineer. Due to the rapid loss of surface bleed water in evaporation volume change in fresh concrete occurs.

Cracking is a common problem experienced by concrete structure due to early age shrinkage in case of slabs type structures that shows much longer surface areas such as pavements, bridge decks precast elements, industrial floors and tunnel lining as compared to other structural components such as beams and columns. There are much more solutions to control or reduce early age shrinkage cracking but introduction of synthetic fiber in addition to a simple concrete mix it has been observed that fiber reduces the cracks forming on the concrete surface.

In this paper the Fibers are introduced in concrete mix by the layer one after the concrete mixture which is found to be very effective in reduction in cracking phenomenon.

I. INTRODUCTION


Concrete is subjected to volume changes autogenously due to the volume change in concrete which is an undesirable property, affects long term strength and durability. Volume change in concrete causes unsightly cracks in concrete therefor volume change in concrete is important to the practical engineer. Due to the rapid loss of surface bleed water in evaporation volume change in fresh concrete occurs. Due the cracking phenomenon water and other chemical agents gets access into concrete and get in contact with steel reinforcements which causes reinforcement corrosion upto to breakage.

Fresh concrete during hot, windy and dry weather conditions vulnerable to shrinkage cracking phenomenon. When the evaporation rate is higher

than bleeding rate, it can cause high tensile stresses that may be enough to exceed the tensile strength of concrete. If the surface cracks that develop as a result of shrinkage remain unnoticed, they become channels for external deteriorating agents and reduce long-term durability.

Recent studies have shown that at a very early age concrete can produce large tensile stresses due to the early loss of moisture from fresh concrete. Volumetric changes caused due to reduction in temperature, chemical reaction and moisture loss early-age cracking phenomenon will be occurred. This reduction in volume results in the evolution of tensile stress in concrete and these tensile stresses when gets exceeds the tensile strength of concrete, a visible crack can be expected to occur.

II. METHODOLOGY

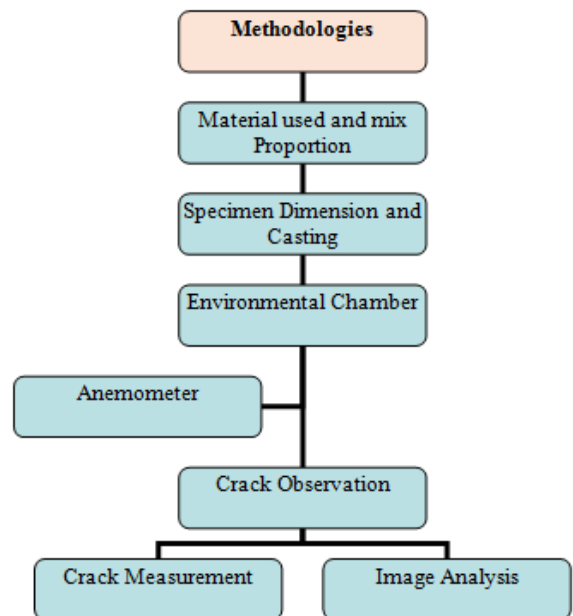

A. Materials Used and Mix Proportions-

Materials Used :

Design Grade	M 40
Cement Type	Ordinary Portland Cement
Brand of Cement	ACC
Sp. Gravity of Cement	3.15
Sp. Gravity of Fine Aggregate	2.55
Sp. Gravity of course Aggregate	2.65
Assumed type of exposure	Severe

Mix Proportions:

Water	Cement	Fine Aggregate (Fa)	Coarse Aggregate (Ca)
189	472	583	1136
0.40	1	1.24	2.41

Fiber Content:

AR-Glass Fiber	Weight (gm)	Polypropylene	Weight (gm)
0 %	0	0 %	0
0.5 %	13.14	0.5 %	13.14
1%	26.29	1%	26.29



Fig. 1 AR Glass Fiber



Fig. 2 Polypropylene

B. Specimen dimension and casting

The slab mould of dimension 60x100x200 mm were used which were made of laminated sheet boards. Before placing of concrete to remove the base friction between concrete and surface of laminated board a thin polyethylene sheet can be used. To provide additional restraint and to avoid longitudinal movement of the concrete from the edge's nails have been used at the ends.



Fig. 3- Specimen Mould

C. Environmental Chamber-

The test phenomenon has been performed during a short period of time i.e. 24h in order to check the cracking related problems in the early age shrinkage. The specimen mould were placed in an environmental chamber having dimensions of 175x350x550 mm as shown in fig. To accelerate the drying of concrete a high-speed fan with regulator is used which is fixed on the walls of the chamber. The fan also controls the temperature and humidity in between the chamber.

After casting and finishing of moulds the surface was exposed to environmental conditions such as, relative humidity of $50 \pm 2\%$, high wind speed of 3.9 m/s and a temperature between $33 \pm 1\text{°C}$ in order to satisfy shrinkage and crack formation phenomena



Fig. 4 - Environmental Chamber

a) Anemometer-

An anemometer is an instrument which measures speed of wind, temperature and wind pressure which is used to measure above mentioned parameters when the samples were in environmental chamber.



Fig. 5 - Anemometer

D. Image analysis

ImageJ analysis software is originated at National Institutes of Health & Laboratory for Optical and Computational Instrumentation (LOCI) which is a Java based image processing application. ImageJ software process in following ways as display, edit, analyze, process, save, and print 8-bit color and point images. It can read many image having file formats like PNG, GIF, JPEG, BMP and many more. ImageJ supports image stacks, a series of images that share in a single window, and it is multithreaded so time absorbing operations will be performed parallelly on multi CPU hardware.

For the better understanding of the development of cracks and the microstructure of the cement based systems Image Analysis software has been used. Using curve tracing tool, the length of crack was determined in the image analysis software to trace the crack then in terms of pixels the length was calculated, after that converted to length units (mm) using the calibration scale.

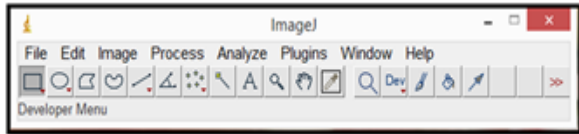


Fig. 6 – Image J Software

E. Crack observation

In case of plain cement concrete, around one hundred and sixty min (160 min) after mixing with water, a fine hairline crack running throughout the width of block was determined above the central stress riser. This fine crack, that might have presumably been caused due to settlement, was found to widen upon further drying with in the case of fiber reinforced concrete specimens.

In case of plain cement concrete, a fine hairline crack was found. However, for fiber concretes no cracks were found.



Fig. 7 – Crack Observation

F. Crack Measurement

The measurements of cracks include of the length, width of crack (max. & avg.) and area of total cracks. For the measurements of cracks images were captured using an optimal zoom camera based on crack visibility, after that image analysis software has been used for processing and editing of captured images to have a clear crack profile using different keys, commands and operations. Below an example is given of an image after the actions taken and operations in Fig. 8.



Fig. 8 – Crack Observation

III. ANALYSIS AND RESULTS

Experimental results show that the cracks having maximum width were observed on plain cement concrete Specimen and no cracks were observed on the fiber added specimen. The overall cracking phenomenon were reduced with addition of synthetic fibers. The test results of the proposed work are described as follows in two contexts mainly AR-Glass Fiber and Polypropylene.

A. Plain Concrete-

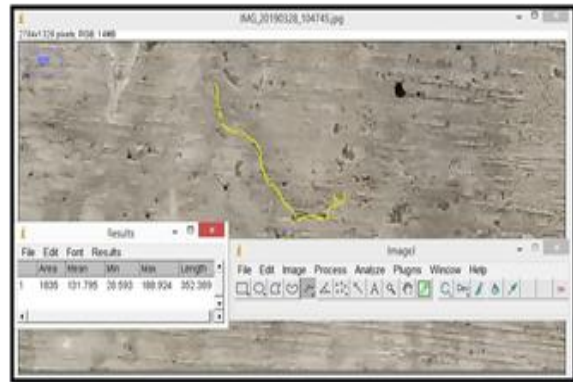


Fig. 8 – Plain Concrete Specimen

B. AR- Glass Fiber Reinforced-



Fig. 10 – AR Glass Fiber Concrete Specimen

C. Polypropylene Fiber Reinforced-



Fig. 10 – Polypropylene Fiber Concrete Specimen

IV. OBSERVATIONS

Sr. No.	Type	Crack Width	Crack Length	Crack Area
1	Plain Concrete	28.59-188.92	352.389	1835
2	AR- Glass Fiber Reinforced	-	-	-
3	Polypropylene Fiber Reinforced	-	-	-

V. CONCLUSIONS

The Experimental Results of addition of synthetic fiber namely Polypropylene and AR-Glass to reduce plastic shrinkage conducted on concrete were reported in this paper. The following conclusions were made from the results discussed are as follows:

1. The addition of fiber in cement concrete specimen resulted to reduction in width also in length reduction.
2. The addition of synthetic Fiber (polypropylene and AR-Glass) shows the best performance in a

certain delay in crack formation and in decreasing the crack phenomenon.

3. The another most important variable is resulted to be the aspect ratio, if the number of fibers used in same magnitude the results will be same.
4. The image processing software named ImageJ were effective not only in measuring the crack width, but also the length which follows the path also uses tight curves and right angles for crack measurements.

REFERENCES

- [1] M. Mazloom, Estimating long-term creep and shrinkage of high-strength concrete, *Cement Concrete Composition 30* (2008) 316–326.
- [2] American Concrete Institute (ACI). Early-age cracking: Causes, measurements, and mitigation. “State-of-the-Art Rep. of ACI Committee 231”, 2008.
- [3] ACI 224 1R–93. Causes, evaluation and repair of cracks in concrete structures. Reapproved 1998. In *Specifications for Structural Concrete, ACI 301–05, with Selected ACI References: Field Reference Manual*, 2005
- [4] N. Banthia, R. Gupta, Influence of polypropylene fiber geometry on plastic shrinkage cracking in concrete, *Cem. Concr. Res.* 36 (7) (2006) 1263–1267.
- [5] N. Banthia, R. Gupta, Test method for evaluation of plastic shrinkage cracking in fiber-reinforced cementitious materials, *Exp. Tech.* 31 (6) (2007) 44–48.
- [6] Grzybowski, M. and Shah, S. P., “Shrinkage Cracking of Fiber Reinforced Concrete, *ACI Materials Journal*, V. 87, No. 2, March-April 1990, pp. 138-148.
- [7] ASTM C1579–06, “Standard test method for evaluating plastic shrinkage cracking of restrained fiber reinforced concrete (using a steel form insert),” American Society of Testing and Materials, Philadelphia (2006).
- [8] B. Yugandhar, Bala Krishna Bharath, K. Jaya Chandra, N. Mohan Reddy, *Experimental Study and Strength of Concrete by Using Glass and Synthetic Fibers* Volume 4 Issue: 12 Dec-2017.

Reference Codes

- [1] Indian Standard Designation IS:12269-1987, Specification for 53 grade ordinary Portland cement, Bureau of Indian Standards, New Delhi, India.
- [2] Indian Standard Designation IS:10262-1982, Recommended Guidelines for Concrete Mix Design, Bureau of Indian Standards, New Delhi, India.
- [3] Indian Standard Designation IS:10262-2009, Recommended Guidelines for Concrete Mix Design, Bureau of Indian Standards, New Delhi, India.